
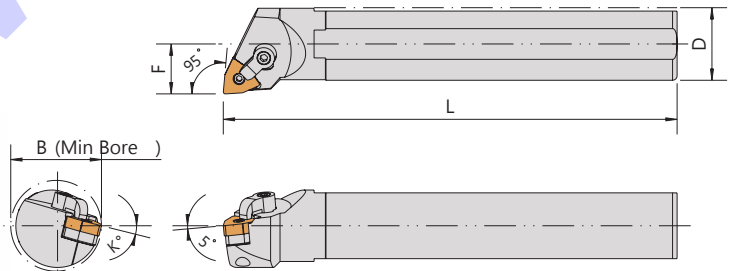


Order No.	Insert	Dimensions					Parts				Wrench		
		Right / Left		D	F	L	B	K°					
S16Q-MTWNR/L16	TNMG1604		16	11	180	20	20°	—	LCS-510	CP50-26S	CS7-5018	LW020	LW025
S20R-MTWNR/L16	TNMG1604		20	13	200	25	17°	—	LCS-510	CP50-26	CS7-5018	LW020	LW025
S25R-MTWNR/L16	TNMG1604		25	17	200	32	12°	—	LCS-510	CP50-22	CS7-6024	LW020	LW030
S32S-MTWNR/L16	TNMG1604		32	20	250	40	10°	SMT-322	LCS-513	CP50-22	CS7-6024	LW020	LW030
S40T-MTWNR/L16	TNMG1604		40	24	300	50	15°	SMT-322	LCS-513	CP50-22	CS7-6030	LW020	LW030
S50U-MTWNR/L16	TNMG1604		50	29	350	57	12°	SMT-322	LCS-513	CP50-22	CS7-6030	LW020	LW030

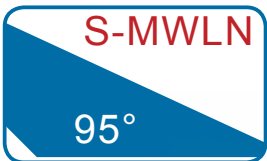

Order No.	Insert	Dimensions					Parts				Wrench		
		Right / Left		D	F	L	B	K°					
S16Q-MWLNR/L06	WNMG0604		16	11	180	22	18°	—	LCS-510	CP50-26	CS7-5018	LW020	LW025
S20R-MWLNR/L08	WNMG0804		20	13	200	25	17°	—	LCS-511	CP50-26	CS7-5018	—	LW025
S25R-MWLNR/L08	WNMG0804		25	17	200	32	14°	—	LCS-511	CP50-22	CS7-6024	LW025	LW030
S32S-MWLNR/L08	WNMG0804		32	22	250	40	14°	SMW-432	LCS-617	CP50-22	CS7-6030	—	LW030
S40T-MWLNR/L08	WNMG0804		40	27	300	50	12°	SMW-432	LCS-617	CP50-22	CS7-6030	—	LW030
S50U-MWLNR/L08	WNMG0804		50	35	350	63	12°	SMW-432	LCS-617	CP50-22	CS7-6030	—	LW030
S63Y-MWLNR/L08	WNMG0804		63	38	500	75	10°	SMW-432	LCS-617	CP50-22	CS7-6030	—	LW030