




Boring Bars 內孔車刀

C-STUB/P
E-STUB/P
93°

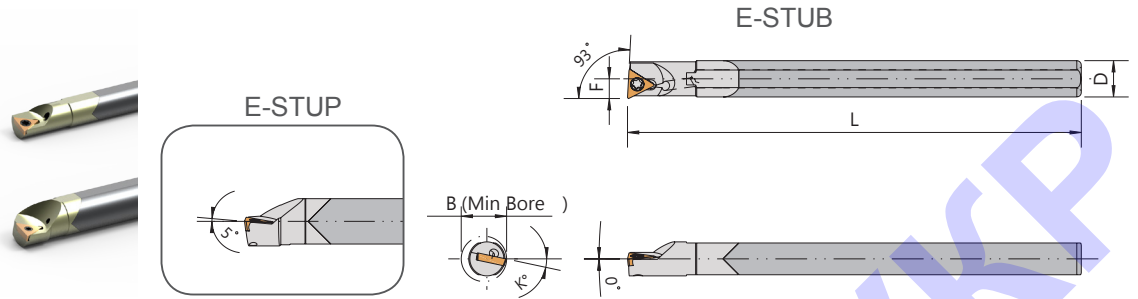

C-Carbide Shank 鎢鋼柄
E-Carbide Shank with Coolant 附油孔鎢鋼柄

Order No.	Insert	Dimensions					Parts	Wrench
Right / Left		D	F	L	B	K°		
C06H-STUBR06-07	TBGT0601	6	3.5	100	7	12°	CS20038	FT-6
C08K-STUBR06-08	TBGT0601	8	4	125	8	10°	CS20038	FT-6
C08K-STUPR08-10	TPGT0802	8	5	125	10	10°	CS20045	FT-6
C10M-STUPR08-12	TPGT0802	10	6	150	12	8°	CS20045	FT-6
C08K-STUPR09-10	TPMT0902	8	5	125	8	10°	CS25065	FT-8
C10M-STUPR09-12	TPMT0902	10	6	150	12	8°	CS25065	FT-8
C10M-STUPR11-12	TPMT1103	10	6	150	12	8°	CSA30060	FT-10
C12Q-STUPR11-14	TPMT1103	12	7	180	14	7°	CSA30060	FT-10
C16R-STUPR11-18	TPMT1103	16	9	200	18	4°	CSA30070	FT-10
C20S-STUPR11-22	TPMT1103	20	11	250	22	2°	CSA30070	FT-10
C20S-STUPR16-22	TPMT1604	20	11	250	22	2°	CS40090	FT-15
C25T-STUPR16-28	TPMT1604	25	14	300	28	2°	CS40090	FT-15
E06K-STUBR06-07	TBMT0601	6	3.5	125	7	12°	CS20038	FT-6
E08M-STUPR08-10	TPMT0802	8	5	150	10	10°	CS20038	FT-6
E10Q-STUPR08-12	TPMT0802	10	6	180	12	8°	CS20045	FT-6
E10Q-STUPR09-12	TPMT0902	10	6	180	12	8°	CS25065	FT-8
E10Q-STUPR11-12	TPMT1103	10	6	180	12	8°	CSA30060	FT-10
E12R-STUPR11-14	TPMT1103	12	7	200	14	7°	CSA30060	FT-10
E16R-STUPR11-18	TPMT1103	16	9	200	18	4°	CSA30070	FT-10
E20S-STUPR11-22	TPMT1103	20	11	250	22	2°	CSA30070	FT-10
E20S-STUPR16-22	TPMT1604	20	11	250	22	2°	CS40090	FT-15
E25T-STUPR16-28	TPMT1604	25	14	300	28	2°	CS40090	FT-15